



PowerPod Lite Instructions




PACKAGE CONTENTS

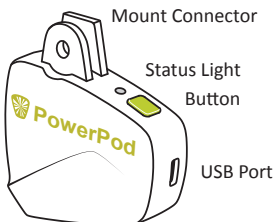


PowerPod Lite sensor

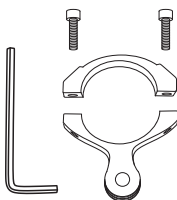



PowerPod mount and mounting hardware



USB cable



1. Charge PowerPod Lite

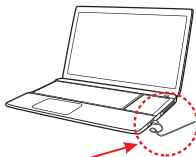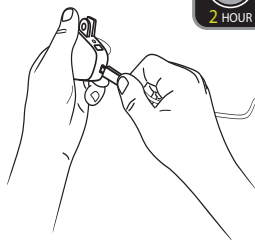


OR



USB charger
(not included)

1A

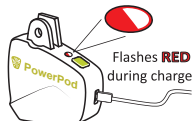


Flashes **RED**
during charge




Light off
fully charged

2. Attach mount to bike

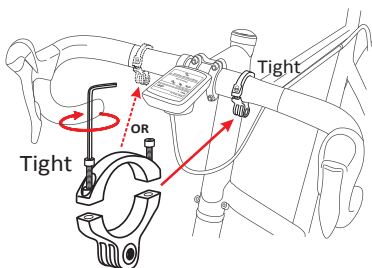

3. Attach PowerPod to mount

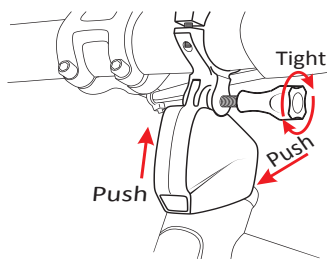


4. Pair PowerPod Lite to ANT+ bike speed sensor




Spin front wheel
to awaken speed sensor

4A

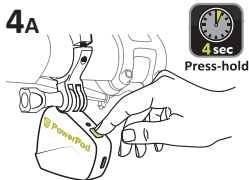

Press-hold button 4 sec. to pair

4B

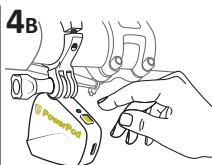

Release button
when **FLASHING GREEN**

4C




"Click"
AFTER successful
pairing light is
SOLID YELLOW

4D




RED: Pairing unsuccessful

5. Pair PowerPod to your ANT+ bike computer

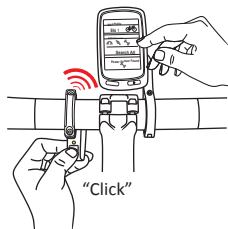

Refer to your ANT+ bike computer manual
for pairing instructions


6. Calibrate

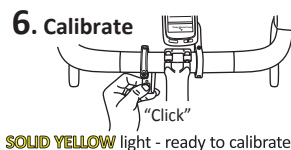

SOLID YELLOW light - ready to calibrate

6A


Flashing
red/green:
click to
start
O&B
cal ride

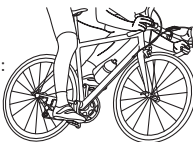

Refer to O&B cal ride instructions sheet


6B

During out, watts go
from 1 to 50;
STOP, ride back
to 100

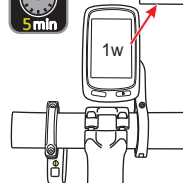


After O&B complete, actual
power shown

7. After Calibration

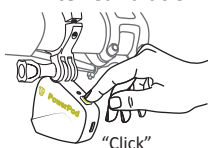


Light **FLASHES GREEN**

7A

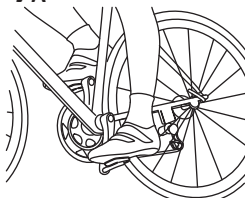

Spin wheel, light changes to
SOLID GREEN

7B

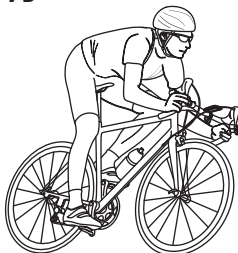

GREEN MEANS GO!